

Cattaraugus County BoE/Museum Exterior Photos



Front of the Museum.



Right side of the Board of Elections.



Large crack on the right side of the Board of Elections.



Left side of Museum.



Back side of the joined buildings:
Board of Elections (left) and Museum (right).



Front entrance to the Board of Elections.
(an addition to the right side of the Museum)

Cattaraugus County Museum Inside Photos



Water infiltration seeping through walls due to the breakdown of brick pointing, and poor roof conditions. This not only caused internal damage but mold as well.



Internal ceiling damage from poor roof conditions (pitch and tar roof).



Field bricks allow water to seep into foundation which weakens structure and causes mold. Stairwell too steep and does not meet current codes or ADA compliance standards.

Cattaraugus County Museum Inside Photos (Cont.)




Front doors are too narrow to meet Americans with Disabilities Act standards.



Original dome was removed after water leaked into the building and caused major damage.



Key elements of the building: Dedication Plaque and Cornerstone will be saved.

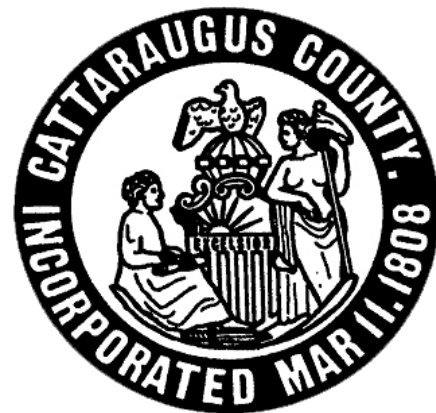

Another key element of the building: Marble plaque naming the building.